Page 1 of 8



# TENNESSEE DEPARTMENT OF TRANSPORTATION EROSION PREVENTION/SEDIMENT CONTROL INSPECTION-REPORT

Reason For Inspection:

Predicted Precipitation Source:

1st Weekly

2nd Weekly

DATE: 10.24.// State Route (SR) / US Route or Road Name and Description: Are corrective actions required by this inspection report (Y/N): YES Wolf River Blvd. County(ies) TDOT PIN: NPDES Permit (NOC) #: Number of New Number of Recurring Number of New Number of Un-Corrected Sediment Releases: Corrective Actions: Corrective Actions: Sediment Releases: Shelby 101615 TNR153299 TDOT Construction No. TDOT Contract No.: Contractor: 7994-1535-54 Acuff Enterprises Inc. I certify, under penalty of law that this document and all attachments were COG EPSC Inspector and Title (print or type): Signature: prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gathered and evaluated Gerald "Jerry" Stanfill information presented. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the Contractor EPSC Inspector and Title (print or type): information, I cerify that inspections of storm water discharge points (outfalls), and of erosion and sediment controls have been performed as recorded in the table Tom Acuff above. I certify that erosion and sediment controls in the drainage area of the identified outfall where installed as planned and designed in working order as COG EPSC Project Manager Signalure recorded in the lable above. I am aware that there are significant penalties for submitting false information, including the possibility of fine and impresonment for (print or type): knowing violations Timothy Bierdz TDOT EPSC Inspection Weekly Rainfall Data Log TDOT/Contractor Agrees with Inspection Report: Predicted Rainfall Rainfall Rainfall Rainfall Rainfall Rainfall Date Day of Week NO (YES) Precipitation Gauge 6 Duration Gauge 1 Gauge 2 Gauge 3 Gauge 4 Gauge 5 If No, explain and initial (hr) (%) (in) (in) (in) (in) (in) (in) Sunday N/A 10-23-11 30 N/A N/A N/A 10.24.11 N/A Monday 10 0 0 N/A N/A N/A 10.25.11 Tuesday N/A N/A N/A N/A 0 10.26.11 Wednesday N/A N/A N/A N/A 10 Thursday N/A N/A N/A N/A 10.27.11 50 N/A 10.21.11 Friday 0 N/A N/A N/A Saturday N/A N/A N/A N/A 10.22-11 0 Sunday N/A N/A N/A N/A Monday N/A N/A N/A N/A (Additional pages may be attached, if needed)

www.weather.com

State/US Route or R

State/US Route or	Road Name:	Wolf River Blvd.

TDOT Construction No.: 79954-3537-54

TDOT Contract No.:

**CONDITION CODES** 

Date	10/24/2011

Outfall Name or Station No.	Rain Gage No.	Approx. Station No. From / To	LT, RT or Centerline	Date Last Disturbed	Date of Stabilization and Code T = Temp. P = Perm.	Existing EPSC Control Measure Codes*	Current Condition Codes*	Corrective Action(s) or Comments
1	1	14+14	LT	10/24/2011		22,35	FM	Weekly cleaning will be required, until further notice.
1A	1	21+50	RT	10/24/2011		41	FM	Backfilling RCBC in progress.
1B	1	22+00	RT	10/24/2011		41	FM	Backfilling RCBC in progress.
1C	1	21+00	LT	10/6/2011	T = 10-6-11	10,12,15,35,41	FM	Monitoring BMP's in place.
2A	1	33+50	LT,CL	10/24/2011		12,15,16,24	I,RO	Additional BMP's needed. See Photos
2B	1	35+50	LT	10/24/2011		16,24	FM	Weekly cleaning for stream crossing required, until further notice. BMP's needed. See Photo
3	1	34+50	LT					The area has not been disturbed.
4	1	40+00	RT	10/24/2011	T = 10-24-11	15,16,43	FM	Temporary stabilized. Monitoring BMP's in place.
5A	1	49+00	RT	10/24/2011		16,33	FM	Monitoring BMP's in place.
5B	1	50+00	RT	10/24/2011		9,16,33	FM	Monitoring BMP's in place.

## **EROSION AND SEDIMENT CONTROL MEASURE CODES**

1	Temporary Silt Fence / Filter Barrier	15	Temporary seeding with Mulch	29	Excess Dirt Removed from Rdwy. Daily	М	Maintenance
2	Temporary Diversion Berm or Ditch	16	Temporary Mulch	30	Haul Roads Dampened for Dust Control	U	Upgrade Needed (Failure Noted)
3	Temporary Slope Drain	17	Erosion Control Blanket	31	Ditch Liner	R	Replacement Needed
4	Rock Check Dams	18	Flexible Channel Liner	32	Rock Silt Screen	FM	Future Maintenance
5	Brush Barrier	19	Catch Basin / Storm Inlet Protection	33	Temporary Silt Fence with Backing	С	Cleaning Needed
6	Sediment Removal	20	Riprap Outlet Structure	34	Enhanced Silt Fence	1	Increase Measures
7	Straw Bale Check	21	Riprap Energy / Velocity Dissipater	35	Sediment Tube	W	Too Wet to Work Conditions
8	Sand Bags	22	Curb, Gutter, or Storm Sewer Protection	36	Sediment Dam	RO	Repeat Occurrence
9	Sediment Trap / Basin	23	Temporary at Construction Exit / Entrance	37	Concrete Washout, other pollution Issues	SR	Sediment Release
10	Temp Sediment Filter Bag / Dewatering	24	Temporary Stream Crossing	38	Berm (soil, riprap, rock)	FS	Final Stabilized
11	Polyethylene Sheeting	25	Turbidity Barrier / Silt Boom	39	Gabion	S	Stable (No Action Needed)
12	Machined Rip Rap	26	Temporary Stream Diversion	40	Sheet Pilling	Other (O31):	
13	Geotextile	27	Preserve Natural Resource / Buffer Zone	41	Haul Road	Other (O#2):	
14	Permanent Seeding with Mulch or Sod	28	Mineral Aggregate Base on Subgrade	42	Bridge Construction	Other (O#3):	
				43	Stream Realignment		

**EPSC Inspection** 

Page 2 of 8

State/US	Route or	Road	Name:
----------	----------	------	-------

Wolf River Blvd.

TDOT Construction No.:

70	00		-	-	-
/ 4	195	0-1		. / _	.n.

TDOT	Contract No.:	
------	---------------	--

Date	10/24/2011

Outfall Name or Station No.	Rain Gage No.	Approx. Station No. From / To	LT, RT or Centerline	Date Last Disturbed	Date of Stabilization and Code	Existing EPSC Control	Current Condition	Corrective Action(s) or Comments
	NO.	From / To			T = Temp. P = Perm.	Measure Codes*	Codes*	
								Weekly cleaning for stream crossing
5C	1	44+00	LT	10/24/2011		16,24	FM	required. (BMP's needed @ New Channel Realignment. See Photo)
6	1	56+00	LT	10/24/2011			FM	Pond has been drained. Currently Stable.
7	1	60+00	RT	10/24/2011		16, 33	FM	Actively clearing and mulching.
8A	1	73+00	RT	10/24/2011		16,24,42	FM	Weekly cleaning for stream crossing will be required, until further notice.
8B	2	75+50	RT	9/29/2011		16,24,35,41	S	Currently Stable, Monitoring BMP's.
8C	1	71+00	LT	10/24/2011		16,35,42	FM	Active construction zone.
8D	2	75+50	LT	10/3/2011	T = 10-3-11	16,35,42	FM	Monitoring BMP's. Weekly watering required until seed establishes.
8E	1	71+50	LT					The area has not been disturbed.
9A	2	80+00	RT	9/29//11	T = 10-3-11	6,15,33,35	FM	Weekly watering required until seed establishes.
9B	2	80+00	LT	9/29//11	T = 10-3-11	15,16,17,,35	FM	Weekly watering required until seed establishes.

### **EROSION AND SEDIMENT CONTROL MEASURE CODES**

### **CONDITION CODES** Temporary Silt Fence / Filter Barrier Temporary Seeding with Mulch Excess Dirt Removed from Rdwy. Daily Maintenance Temporary Diversion Berm or Ditch 30 2 16 Temporary Mulch Haul Roads Dampened for Dust Control U Upgrade Needed (Failure Noted) Erosion Control Blanket Temporary Slope Drain 17 31 Ditch Liner Replacement Needed Rock Check Dams 4 18 Flexible Channel Liner 32 Rock Silt Screen FM **Future Maintenance** 5 Brush Barrier 19 Catch Basin / Storm Inlet Protection 33 Temporary Silt Fence with Backing Cleaning Needed 6 Sediment Removal 20 Riprap Outlet Structure 34 Enhanced Silt Fence Increase Measures 7 Straw Bale Check 21 35 W Riprap Energy / Velocity Dissipater Sediment Tube Too Wet to Work Conditions 8 Sand Bags 22 Curb, Gutter, or Storm Sewer Protection 36 Sediment Dam RO Repeat Occurrence 9 Sediment Trap / Basin 23 Temporary at Construction Exit / Entrance 37 Concrete Washout, other pollution Issues SR Sediment Release Temp Sediment Filter Bag / Dewatering 10 24 Temporary Stream Crossing 38 Berm (soil, riprap, rock) Final Stabilized Polyethylene Sheeting 11 25 Turbidity Barrier / Silt Boom 39 Gabion S Stable (No Action Needed) 12 Machined Rip Rap 26 Temporary Stream Diversion 40 Sheet Pilling Other (O31): Preserve Natural Resource / Buffer Zone 13 Geotextile 27 41 Haul Road Other (O#2): 14 Permanent Seeding with Mulch or Sod Mineral Aggregate Base on Subgrade **Bridge Construction** Other (O#3):

State/US	Route	or	Road	Name
		-		

28

Mineral Aggregate Base on Subgrade

VV	olf	River	Rlvd
vv	VIII	IVIVE	DIVU.

TDOT Construction No.:

79954-3537-54

TDOT Contract No.:

Date	10/24/2011

Outfall Name or Station No.	Rain Gage No.	Approx. Station No. From / To	LT, RT or Centerline	Date Last Disturbed	Date of Stabilization and Code T = Temp. P = Perm.	Existing EPSC Control Measure Codes*	Current Condition Codes*	Corrective Action(s) or Comments
9C	2	79+50	LT	9/29/2011	T = 10-03-11	15,16,20,33	FM	Weekly watering required until seed establishes.
10A	2	85+00	RT	9/29/2011		15,16,35,41	FM	Currently active construction site. Sand bag upstream, remove daily during construction.
10B	2	85+00	RT	9/29/2011		15,16,35,41	FM	No work done in this area on inspection date.
10C	2	85+50	LT	9/29/2011		10,15,16,35,41	FM	No work done in this area on inspection date.
10D	2	84+50	LT	9/29/2011		10,15,16,35,41	FM	No work done in this area on inspection date.
11A	2	92+50	RT	10/24/2011		35,41	FM	Backfilling RCBC in progress.
11B	2	92+50	LT	10/6/2011		10,32,35,41	W	Remove floatables. See photo
11C	2	92+00	LT	10/6/2011		10,32,35,41	W	Remove floatables. See photo
	1	11+28	LT	10/24/2011		19,35	FM	Daily cleaning is required, until further notice.
	1	13+40	RT	10/24/2011		23,29,30	FM	Daily cleaning will be required, until further notice.
	1	107+75	CL	10/24/2011	EASURE CODES	23,29,30	FM	Daily cleaning will be required, until further notice.

### EROSION AND SEDIMENT CONTROL MEASURE CODES **CONDITION CODES** Temporary Silt Fence / Filter Barrier 15 Temporary Seeding with Mulch 29 Excess Dirt Removed from Rdwy. Daily M Maintenance 2 Temporary Diversion Berm or Ditch 16 Temporary Mulch 30 Haul Roads Dampened for Dust Control U Upgrade Needed (Failure Noted) 3 Temporary Slope Drain 17 Erosion Control Blanket 31 Ditch Liner R Replacement Needed 4 Rock Check Dams 18 Flexible Channel Liner 32 Rock Silt Screen FM **Future Maintenance** 5 Brush Barrier 19 Catch Basin / Storm Inlet Protection 33 Temporary Silt Fence with Backing Cleaning Needed Sediment Removal 6 20 Riprap Outlet Structure Enhanced Silt Fence Increase Measures 7 Straw Bale Check 21 Riprap Energy / Velocity Dissipater 35 Sediment Tube W Too Wet to Work Conditions 8 Sand Bags 22 Curb, Gutter, or Storm Sewer Protection 36 Sediment Dam RO Repeat Occurrence 9 Sediment Trap / Basin 23 Temporary at Construction Exit / Entrance 37 Concrete Washout, other pollution Issues SR Sediment Release 10 Temp Sediment Filter Bag / Dewatering 24 Temporary Stream Crossing 38 Berm (soil, riprap, rock) FS Final Stabilized 11 Polyethylene Sheeting 25 Turbidity Barrier / Silt Boom 39 Gabion S Stable (No Action Needed) 12 Machined Rip Rap 26 Temporary Stream Diversion 40 Sheet Pilling Other (O31): 13 Geotextile 27 Preserve Natural Resource / Buffer Zone 41 Haul Road Other (O#2): Permanent Seeding with Mulch or Sod

Bridge Construction

Other (O#3):

ÖFT	IE S	
GRIC	TURE	

State/US Route or Road Name:	Wolf River Blvd.	TDOT Construction No.:	79954-3537-54	TDOT Contract No.:
				the second secon

Date	10/24/2011

Outfall Name	Rain	A	LT DT	D.I.I.I	Date of	Existing		
or Station No.	Gage	Approx. Station No.	LT, RT or Centerline	Date Last Disturbed	Stabilization and Code	EPSC Control	Current Condition	Corrective Action(c) on Comment
*(Existing	No.	From / To	Centerinie	Disturbed	T = Temp.	Measure	Condition Codes*	Corrective Action(s) or Comments
Structure)	110.	1 101117 10			P = Perm.	Codes*	Codes	
, i					1 101111.	Codes		Daily cleaning will be required, until further
* 109+51	2	East side of WRB	RT	10/24/2011		19,22	FM	notice.
26 CONTRACTOR SE 19		South side of						Daily cleaning will be required, until further
* 109+11	2	Farmington	RT	10/24/2011		19,22	FM	notice.
+ 40.00	2	North side of				ecanie zinewo	2605-060000	Daily cleaning will be required, until further
* 12+80	1	WRB	LT	10/24/2011		19,22	FM	notice.
		Walking Trail						
	1	36+00	LT	7/20/2011	T = 7-20-11	5,35	S	Currently stable, Monitoring BMP's
	1	Sta. 29+50 Slope	LT	7/20/2011	T= 9-01-11	16	S	Currently stable.
		Sta. 13+40 -		772072011	1 0 01 11	10		
		Sta. 107+75	LT, RT or CL	10/13/2011		20		Haul roads dampened frequently for dust
		Ota. 107173	LI, KI OI CL	10/13/2011		30	FM	control, until further notice.
	2	76+50 - 103+46	RT	9/29/2011	T = 10-03-11	15,16,35	FM	Weekly watering required until seed establishes.
	2	92+50 - 107+00	LT	0/00/0044	T 40.00.44	45.40.05		
		92+50 - 107+00	LT	9/29/2011	T = 10-03-11	15,16,35	FM	Weekly watering required until seed establishes.
	1	6+75	LT	10/24/2011		10.00	FM	Daily cleaning will be required, until further
		0.75	L1	10/24/2011		19,22	FIVI	notice.
	1	27+00	RT	10/3/2011	T= 10-03-11	15,16	S	Currently stable, Monitoring BMP's
	1	34+00	RT	8/25/2011	T= 8-25-11	16	S	Currently stable, Monitoring BMP's
		EROSIC	ON AND SEDIMEN	T CONTROL ME	ASURE CODES		•	CONDITION CODES

## EROSION AND SEDIMENT CONTROL MEASURE CODES

1	Temporary Silt Fence / Filter Barrier	15	Temporary Seeding with Mulch	29	Excess Dirt Removed from Rdwy. Daily	M	Maintenance
2	Temporary Diversion Berm or Ditch	16	Temporary Mulch	30	Haul Roads Dampened for Dust Control	U	Upgrade Needed (Failure Noted)
3	Temporary Slope Drain	17	Erosion Control Blanket	31	Ditch Liner	R	Replacement Needed
4	Rock Check Dams	18	Flexible Channel Liner	32	Rock Silt Screen	FM	Future Maintenance
5	Brush Barrier	19	Catch Basin / Storm Inlet Protection	33	Temporary Silt Fence with Backing	С	Cleaning Needed
6	Sediment Removal	20	Riprap Outlet Structure	34	Enhanced Silt Fence	1	Increase Measures
7	Straw Bale Check	21	Riprap Energy / Velocity Dissipater	35	Sediment Tube	W	Too Wet to Work Conditions
8	Sand Bags	22	Curb, Gutter, or Storm Sewer Protection	36	Sediment Dam	RO	Repeat Occurrence
9	Sediment Trap / Basin	23	Temporary at Construction Exit / Entrance	37	Concrete Washout, other pollution Issues	SR	Sediment Release
10	Temp Sediment Filter Bag / Dewatering	24	Temporary Stream Crossing	38	Berm (soil, riprap, rock)	FS	Final Stabilized
11	Polyethylene Sheeting	25	Turbidity Barrier / Silt Boom	39	Gabion	S	Stable (No Action Needed)
12	Machined Rip Rap	26	Temporary Stream Diversion	40	Sheet Pilling	Other (O31):	•
13	Geolextile	27	Preserve Natural Resource / Buffer Zone	41	Haul Road	Other (O#2):	
14	Permanent Seeding with Mulch or Sod	28	Mineral Aggregate Base on Subgrade	42	Bridge Construction	Other (O#3):	

**EPSC Inspection** 

ON THE STA	
APA	
AGRICUTURE	
1796	

0 id Name:	Wolf River Blvd.	TDOT Construction No.:	79954-3537-54	TDOT Contract No.:	


Date 10/24/2011

Outfall Name or Station No.	Rain Gage No.	Approx. Station No. From / To	LT, RT or Centerline	Date Last Disturbed	Date of Stabilization and Code T = Temp. P = Perm.	Existing EPSC Control Measure Codes*	Current Condition Codes*	Corrective Action(s) or Comments
***************************************					1 3 31 31111	00000		Weekly watering required until seed
	1	21+33 - 26+00	LT	10/10/2011	T = 10-6-11	15,16,35,41	FM	establishes.
	1	21+33 - 26+00	RT	10/10/2011	T = 10-6-11	15,16,35,41	FM	Weekly watering required until seed establishes.
	1	25+00	LT	9/29/2011	T = 10-6-11	15,16,33,35,41	FM	Currently stable, monitoring BMP's.
	1	25+00	RT	9/29/2011	T = 10-6-11	15,16,33,35,41	FM	Currently stable, monitoring BMP's.
	1	27+50	RT	10/6/2011	T = 10-6-11	15,16,33,35,41	FM	Currently stable, monitoring BMP's.
	1	31+90	RT	9/29/2011	T = 10-6-11	15,16,35	FM	Currently stable, monitoring BMP's.
	1	15+60	RT	9/15/2011	T = 10-6-11	15,16,33,35	FM	Currently stable, monitoring BMP's. Weekly watering required until seed establishes.
* 108+37		North side of WRB	LT	10/24/2011		19,22	FM	Daily cleaning will be required, until further notice.
	1	23+00 - 26+00	RT	9/29/2011	T = 10-6-11	33,41	FM	Currently stable, monitoring BMP's.

## **EROSION AND SEDIMENT CONTROL MEASURE CODES**


### CONDITION CODES Temporary Silt Fence / Filter Barrier 1 Temporary Seeding with Mulch Excess Dirt Removed from Rdwy. Daily M Maintenance 2 Temporary Diversion Berm or Ditch 16 Temporary Mulch 30 Haul Roads Dampened for Dust Control U Upgrade Needed (Failure Noted) Temporary Slope Drain 3 17 **Erosion Control Blanket** 31 Ditch Liner Replacement Needed Rock Check Dams 4 18 Flexible Channel Liner Rock Silt Screen FM Future Maintenance 5 Brush Barrier 19 Catch Basin / Storm Inlet Protection Temporary Silt Fence with Backing С Cleaning Needed 6 Sediment Removal 20 Riprap Outlet Structure **Enhanced Silt Fence** Increase Measures 7 Straw Bale Check 21 Riprap Energy / Velocity Dissipater 35 Sediment Tube Too Wet to Work Conditions Sand Bags 8 22 Curb, Gutter, or Storm Sewer Protection Sediment Dam RO Repeat Occurrence Sediment Trap / Basin 9 Temporary at Construction Exit / Entrance Concrete Washout, other pollution Issues SR Sediment Release 10 Temp Sediment Filter Bag / Dewatering 24 Temporary Stream Crossing Berm (soil, riprap, rock) Final Stabilized Polyethylene Sheeting S 11 25 Turbidity Barrier / Silt Boom Gabion Stable (No Action Needed) Machined Rip Rap 12 26 Temporary Stream Diversion Sheet Pilling Other (O31): 13 Geotextile 27 Preserve Natural Resource / Buffer Zone Haul Road Other (O#2): 14 Permanent Seeding with Mulch or Sod 28 Mineral Aggregate Base on Sub grade Other (O#3): **Bridge Construction**

EPSC Inspection Page 6 of 8

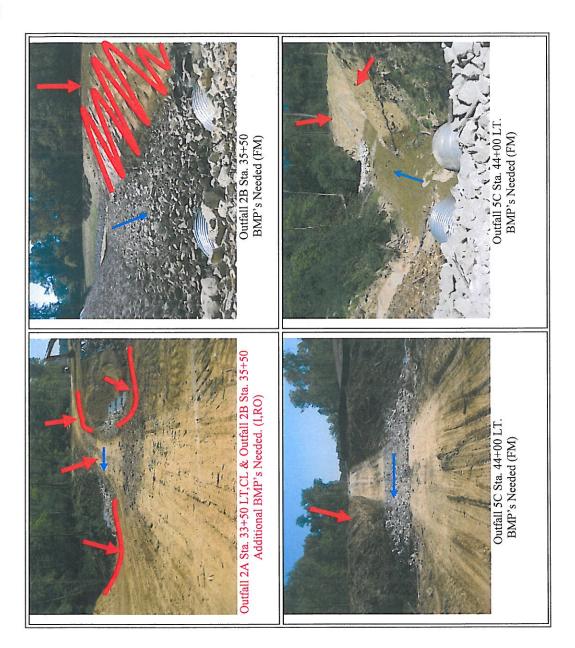



City of Germantown 1920 S. Germantown Road Germantown, TN 38138

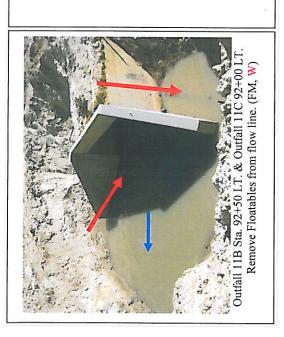

No Picture



City of Germantown 1920 S. Germantown Road Germantown, TN 38138